

Analyzing syn1588® PTP Stack link status

Version 1.17.1 - October 2023

Abstract

After running the first tests using the syn1588® PTP Stack as described in the syn1588® PCle NIC Quick Start Guide one starts setting up a real-life PTP system in a more complex scenario. This application note describes how to analyze the PTP port status using very simple means to identify frequent configuration issues like IP address mis-assignments, network issues or firewall configurations blocking the traffic.

Scenario

After having completed the first simple tests using the syn1588® PTP Stack most likely together with the syn1588® PCle NIC following the Application Note "syn1588® PCle NIC Quick Start Guide" (AN004, Version 1.6 - May 2019). Everything runs smoothly so far. But now you connect to your real-life network using your PTP Grandmaster.

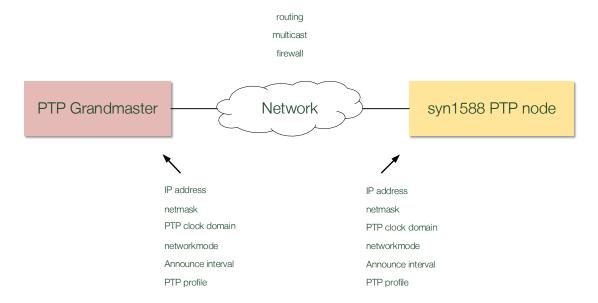


figure 1 Application scenario

Frequently you do not have direct access to the PTP Grandmaster in the network as well as the network infrastructure (switches etc.) since they are managed by your IT department. This application note provides you simple guidelines on how to identify connection or configuration issues using very simple means.

Your Tools

There are two very simple tools one can use to analyze the proper PTP communication on your node.

syn1588® PTP Stack Log Output

This "tool" comes free of charge with the syn1588® PTP Stack. The syn1588® PTP Stack provides a detailed log output with selectable verbosity level "-v <verbosity level>". While for normal operation a log level of 1 or 2 is sufficient one is interested in all details (log level 4) during debugging or setup procedure.

You can easily figure out network or PTP configuration issues by analyzing the output. The following listing shows such a typical syn1588® PTP Stack log output.

```
oregano@KAEFER:/opt/oregano/bin$ sudo ./ptp -i enp2s0 -C S -v info
023-10-04 16:43:58.651988 [INFO
                                 ] [
                                                   1 svn1588(R) PTP Stack -
IEEE1588-2008 Engine
                                            software Build date: 2023-10-
2023-10-04 16:43:58.652103 [INFO
03T05:02:37 - v1.17-5-ge201e4a9e
                                            build information (c) Oregano Systems
2023-10-04 16:43:58.652122 [INFO
 Design & Consulting GesmbH 2005-2023
                                                    ] Confidential unpublished data
2023-10-04 16:43:58.652138 [INFO
- All rights reserved
2023-10-04 16:43:58.652156 [INFO
                                    ] [
                                                    ] syn1588(R) PTP Stack started:
2023-10-04 16:43:58 (UTC)
2023-10-04 16:43:58.652486 [INFO
                                                    Port 1: adding config "i" =
                                    ] [p1
"eth0"
2023-10-04 16:43:58.652526 [INFO
                                    ] [p1
                                                   ] Port 1: adding config "C" =
"5"
2023-10-04 16:43:58.652551 [INFO
                                                    ] Port 1: adding config "v" =
                                    ] [p1
"info"
2023-10-04 16:43:58.652571 [INFO
                                    ] [p1
                                                    1 PTP version 2.0
2023-10-04 16:43:58.652591 [INFO
                                                    ] Command line:
                                  1 [
/opt/oregano/bin/ptp -i eth0 -C S -v info
2023-10-04 16:43:58.652630 [WARNING ] [
                                                    ] Failed to set high priority
for the PTP thread!
2023-10-04 16:43:58.652661 [INFO
                                    ] [p1
                                                   ] Found Configuration for 1
2023-10-04 16:43:58.653556 [INFO
                                    ] [syn1588
                                                    ] Syn1588Ifc requires at least:
2023-10-04 16:43:58.653589 [INFO
                                    ] [syn1588
                                                       - linux driver version 1.4-15-
a05b7283
2023-10-04 16:43:58.653608 [INFO ] [syn1588 ^{\circ} 10/05/2017, 10.9.16.182 syn1588 hardware
                                                    ] - windows driver version
2023-10-04 16:43:58.653679 [INFO
                                                       Device /dev/syncD0 found
2023-10-04 16:43:58.653802 [INFO
                                                       syn1588(R) PCIe NIC Revision
2.1, Build 999 with HQ Oscillator
                                    syn1588® hardware to read syn1588 PCIe
2023-10-04 16:43:58.653837 [ERFOR
NIC board revision
                                    build information led to read board serial
2023-10-04 16:43:58.653886 [ERROR
2023-10-04 16:43:58.653923 [INFO
                                    ] [p1
                                                    ] Using syn1588 mode
2023-10-04 16:43:58.657558 [INFO
                                                    ] Licensed as: syn1588(R) PTP
                                    ] [p1
Stack full version
2023-10-04 16:43:58.657904 [INFO
                                    ] [syn1588 ] syn1588HwClk: clearing leap
second jump
```

```
2023-10-04 16:43:58.657952 [INFO
                                  ] [pl.engine ] Settings: ClockId
8c:a5:a1:ff:fe:00:11:bc
2023-10-04 16:43:58.657977 [INFO
                                 ] [p1.engine ] Settings: Prio1 128 ClkClass
255 clkAccuracy 39 clkVariance 0xFFFF
2023-10-04 16:43:58.657999 [INFO
                                 ] [p1.engine
                                               ] Settings: Prio2 128 Domain 0
                                  [p1.network.mcport] Activated SO_TIMESTAMPING
2023-10-04 16:43:58.658461 [INFO
hardware
2023-10-04 16:43:58.658781 [INFO
                                 ] [p1.network.mcport] Activated SO TIMESTAMPING
hardware
2023-10-04 16:43:58.659583 [INFO
                                 ] [p1.clock
                                                ] Using Oregano Systems;
syn1588(R) PCIe NIC Revision 2.1; 8C:A5:A1:00:11:BC with ClockId
8c:a5:a1:ff:fe:00:11:bc
2023-10-04 16:43:58.660302 [INFO
                                  ] [syn1588
                                                 ] syn1588HwClk: clearing leap
second jump
2023-10-04 16:43:59.659808 [INFO
                                  ] [p1.engine
                                                  ] State Change Initializing ->
Listening
2023-10-04 16:43:59.659939 [INFO
                                  ] [syn1588
                                                 ] syn1588HwClk: UTC offset
changed to 37 s
2023-10-05 08:12:43.507048 [INFO
                                  ] [p1.engine
                                                 ] Selected Master
EC:46:70:FF:FE:0A:0A:0A
2023-10-05 08:12:43.507101 [INFO
                                  ] [p1.engine
                                                ] State Change Listening ->
Uncalibrated
2023-10-05 08:12:43.757329 [INFO
                                  ] [pl.engine
                                                 ] PTP Master Clock Selected
2023-10-05 08:12:44.447065 [INFO
                                                  ] PTP Master Clock Selected
                                  ] [p1.engine
Slave
2023-10-05 08:12:48.560549 [INFO
                                  ] [p1.clock
                                                 ] compensated offset
successfully
2023-10-05 08:12:51.601412 [INFO
                                                 ] changed synchronization
                                ] [p1.clock
boundary threshold to 1000.00 [ns] (14)
2023-10-05 08:12:59.700361 [INFO
                                                 ] Sync in bound
                                 ] [p1.clock
1696486416.700155883 Ofs: 645 [ns]
2023-10-05 08:13:06.784479 [INFO
                                 ] [p1.clock
                                                 ] changed synchronization
boundary threshold to 2500.00 [ns] (13)
2023-10-05 08:13:06.784568 [WARNING ] [p1.clock
                                                 ] Sync out of bound :
1696486423.784364822 Ofs:
                            1005 [ns]
2023-10-05 08:13:07.798115 [INFO ] [p1.clock
                                                ] changed synchronization
boundary threshold to 1000.00 [ns] (14)
2023-10-05 08:13:15.896931 [INFO
                                                ] Sync in bound
                                 ] [p1.clock
                             519 [ns]
1696486432.896721303 Ofs:
```

figure 2 syn1588® PTP Stack: example log output verbosity level info

Wireshark

Wireshark is a network traffic and protocol recorder and analyzer. You can download this free software here: https://www.wireshark.org/

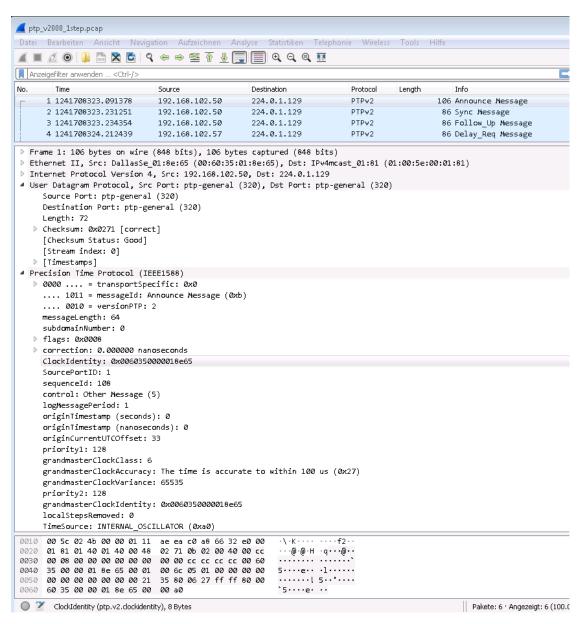


figure 3 Wireshark trace window

Analysis Procedure

The PTP communication (assuming one is using Layer 3 communication, thus UDP via either IPv4 or IPv6) requires a proper setup of the IP communication your system. This is nothing specific to PTP. You have to ensure a proper IP routing from your PTP node, using the selected network interface (typically a syn1588® PCle NIC) to the Grandmaster. This basic IP setup shall be done using the standard operating system commands or procedures.

Check basic IP communication

One can use the PING command from a shell (DOS command window on Windows machines or any terminal on Linux machines) for this purpose. Simply ping the IP address of your PTP Grandmaster on the network.

```
[user@hugo a]$ ping 192.168.1.20
PING 192.168.1.20 (192.168.1.20) 56(84) bytes of data.
64 bytes from 192.168.1.20: icmp_seq=1 ttl=128 time=0.766 ms
64 bytes from 192.168.1.20: icmp_seq=2 ttl=128 time=0.490 ms
64 bytes from 192.168.1.20: icmp_seq=3 ttl=128 time=0.557 ms
64 bytes from 192.168.1.20: icmp_seq=4 ttl=128 time=0.509 ms
^C
--- 192.168.1.20 ping statistics ---
4 packets transmitted, 4 received, 0% packet loss, time 3375ms
rtt min/avg/max/mdev = 0.490/0.580/0.766/0.112 ms
```

figure 4 Using PING to test basic IP communication

Caution

If your node owns several network interfaces you have to ensure proper IP routing. The PING test just gives you the information that there is a proper route from your node to the Grandmaster. It does not give you the information whether the network interface you plan to use for the PTP communication offers the required IP settings for proper IP communication.

Check PTP traffic on network interface

Now one can use Wireshark to check the incoming network traffic on the network interface one plans to use for PTP communication. One can simply filter the traffic for PTP messages only by entering the string "ptp" into the filtering window. Now, Wireshark displays all PTP messages seen on the selected network interface.

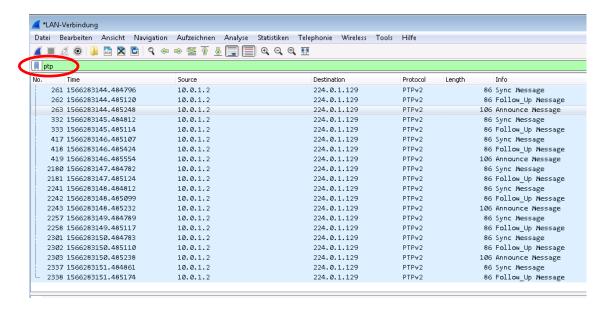


figure 5 Wireshark: check for PTP traffic

Caution

Wireshark is a network debugging tool. It does not care about proper IP settings nor on active firewalls or multicast routings on your node. You will see any message physically visible on the network interface although higher levels of your operating systems are instructed to block or re-route this traffic.

Check for syn1588® hardware

If one runs the syn1588® PTP Stack on a syn1588® PCle NIC one can check whether the correct network interface had been chosen when invoking the syn1588® PTP Stack. The syn1588® PCle NIC has to be reported in the log file as shown in the following example:

```
oregano@KAEFER:/opt/oregano/bin$ sudo ./ptp -i enp2s0 -C S -v info -r 0
                                                    ] syn1588(R) PTP Stack -
 2022-01-05 15:48:48.845172 [INFO ] [
 IEEE1588-2008 Engine
2022-01-05 15.48:48.845206 [INFO 05T12:43:16 - v1.14-9-g7cbf9e73
                                            software Build date: 2022-01-
2022-01-05 15:48:48.845212 [INFO
                                    ] [
                                            build informationt (c) Oregano Systems
 - Design & Consulting GesmbH 2005-2022
 2022-01-05 15:48:48.845217 [INFO
                                                    | Confidential unpublished data
                                   1 [
 - All rights reserved
 2022-01-05 15:48:48.845224 [INFO
                                                   ] syn1588(R) PTP Stack started:
                                    ] [
 2022-01-05 14:48:48.845222 (UTC)
 2022-01-05 15:48:48.845317 [INFO
                                    ] [p1
                                                   ] Port 1: adding config "i" =
 "enp2s0"
 2022-01-05 15:48:48.845327 [INFO
                                    ] [p1
                                                   ] Port 1: adding config "C" =
 2022-01-05 15:48:48.845333 [INFO
                                    ] [p1
                                                   ] Port 1: adding config "v" =
 "info"
 2022-01-05 15:48:48.845338 [INFO
                                    ] [p1
                                                    Port 1: adding config "r" =
 2022-01-05 15:48:48.845344 [INFO
                                    ] [p1
                                                   ] PTP version 2.0
 2022-01-05 15:48:48.845348 [INFO
                                    ] [
                                                   ] Command line: ./ptp -i enp2s0
 -C S -v info -r 0
 2022-01-05 15:48:48.845358 [WARNING ] [
                                                    ] Failed to set high priority
 for the PTP thread!
 2022-01-05 15:48:48.845365 [INFO
                                                   ] Found Configuration for 1
                                    [p1
 2022-01-05 15:48:48.845563 [INFO
                                    ] [syn1588
                                                    ] Syn1588Ifc requires at least:
 2022-01-05 15:48:48.845571 [INFO
                                    ] [syn1588
                                                    ] - linux driver version 1.4-15-
 q05b7283
 2022-01-05 15:48:48.845576 [INFO
                                    ] [syn1588
                                                    1 - windows driver version
 10/05/2017, 10.9.16.182
2022- syn1588® hardware found 1588 2022-01-05 15:48:48.845608 [INFO ] [syn1588
                                                     Device /dev/syncD0 found
                                                ] syn1588(R) Hardware Clock M
                                    ] [syn1588
 2.3.5 f=125000000 Hz
 2022-01-05 15:48:48.845617 [INFO
                                    ] [syn1588
                                                   ] Found stop clock support
                                                   ] Using MAC TS Version 3160
 2022-01-05 15:48:48.845630 [INFO
                                    ] [syn1588
 2022-01-05 15:48:48.845635 [INFO
                                    ] [syn1588
                                                    ] Using programmable 1-step TS
 2022-01-05 15-48:48sV11588<sup>®</sup> Hardwaren1588
                                                   ] syn1588(R) PCIe NIC Revision
2, Build 876
 2022-01-05 15-48:48 build information[p1
                                                    ] Using syn1588 mode
 2022-01-05 15:48:48.845699 [INFO ] [p1.clock
                                                    ] Spike M2S: Init with ival 0,
buffer size 16
 2022-01-05 15:48:48.845762 [INFO
                                  ] [p1.clock
                                                   ] Spike Path: Init with ival 0,
 buffer size 16
                                                     ClockID derived from
                                  ] [p1.io
 2022-01-05 15:48:48.845778 [INFO
                                                    1
                                                       Init shared mem
                                    ] [syn1588
                                                    JMAG1 address clearing leap
 2022-01-05 15:48:48.848090 [INFO
 second jump
 2022 01 05 15:48:48.848103 Using Oregano Systems, syn1588(R) PCIe NIC Revision 2.1;
8C:A5:A1:00:11:BC with ClockId 8c:a5:a1:ff:fe:00:11:bc
 20zz-01 05 15·48:48.848112 [INFO ] [pl engine
                                                       Settings: Prio1 128 ClkClass
 255 clkAccuracy 39 clkVariance 65535
```

figure 6 syn1588® PTP Stack: check for syn1588® hardware

If one runs the syn1588® PTP Stack on any network interface card no syn1588® hardware support will be found and reported as shown in the next example.

```
2022-01-07 13:24:24.758827 [INFO
                                                 ] syn1588(R) PTP Stack -
                                  1 [
IEEE1588-2008 Engine
2022-01-07 13:24:24.758888 [INFO
                                                 ] Build date: 2021-12-
                                  ] [
22T13:51:43 - v1.13-260-g3d9f6485
2022-01-07 13:24:24.758935 [INFO
                                  ] [
                                                 ] Command line: ./ptp -i enp3s0
-C S -v info -f /home/oregano/Documents/ptp_intelnic_hwmode.txt
2022-01-07 13:24:24.759002 [INFO
                                                 ] syn1588(R) PTP Stack started:
                                 ] [
2022-01-07 12:24:24.758995 (UTC)
2022-01-07 13:24:24.759050 [INFO
                                                 ] Command line: ./ptp -i enp3s0
                                 ] [
-C S -v info -f /home/oregano/Documents/ptp_intelnic_hwmode.txt
2022-01-07 13:24:24.759106 [WARNING ] [
                                                 ] Failed to set high priority
for the PTP thread!
2022-01-07 13:24:24.759179 [INFO
                                                 | Found Configuration for 1
                                  [q] [
2022-01-07 13:24:24.761645 [INFO
                                  ] [syn1588
                                                ] Syn1588Ifc requires at least:
2022-01-07 13:24:24.761 no syn1588® hardware support
                                                            driver version 1.4-15-
2022-01-07 13:24:24.761772

    windows driver version

10/05/2017,
          10.9.16.182
2022-01-07 13:24:24.761947 [WARNING ] [p1
                                                  ] There is no card with the
given ClockID available
2022-01-07 13:24:24.762095 [INFO
                                                  ] Device /dev/ptpl fo
                                  [p1
2022-01-07 13:24:24./02168
                                                     Using PHC mode
2022-01-07 13:24:24.762311 [INFO
                                  ] [p1.clock
                                                 ] Spike M2S: Init with ival 0,
buffer size 16
                                  [p1.clock ] Spike Path: Init with ival 0,
2022-01-07 13:24:24.762718 [INFO
buffer size 16
2022-01-07 13:24:24.762789 [INFO
                                  ] [p1.io
                                                 l Init shared mem
2<del>022-</del>01-07 13:24:24.767247 [INFO
                                    [pl.engine
                                                ] Settings: ClockId
68:05:ca:ff:fe:2c:da:ca
                                      ClockID derived from MAC address
2022-01-07 13.21:21.76732
                                  ] [pl.engine
                                                  ] Settings: Priol 128 ClkClass
255 clkAccuracy 39 clkVariance 65535
2022-01-07 13:24:24.767366 [INFO ] [p1.engine
                                                ] Settings: Prio2 128 Domain 0
2022-01-07 13:24:24.768093 [INFO
                                 ] [pl.network.mcport] SIOCSHWTSTAMP: tx type 1
requested, got 1; rx filter 0 requested, got 12
2022-01-07 13:24:24.768171 [INFO ] [p1.network.mcport] Activated SO TIMESTAMPING
hardware
2022-01-07 13:24:24.768804 [INFO
                                  [p1.network.mcport] SIOCSHWTSTAMP: tx_type 1
requested, got 1; rx_filter 0 requested, got 12
2022-01-07 13:24:24.768880 [INFO ] [p1.network.mcport] Activated SO TIMESTAMPING
hardware
                                                   Clk: Using Linux PHC;;
2022-01-07 13:24:2
                   Using Linux PHC mode (
2022-01-07 13:24:2
                                                      with ClockId
68:05:ca:ff:fe:2c:da:ca
2022-01-07 13:24:24.771834 [INFO
                                  ] [p1.clock
                                                  ] Clk: Resetting servos
                                                 ] Clk: Resetting filters
2022-01-07 13:24:24.771941 [INFO
                                 ] [p1.clock
```

figure 7 syn1588® PTP Stack: without syn1588® hardware (but with Linux PHC support)

Check for ANNOUNCE messages

After successfully starting the syn1588® PTP Stack on the intended network interface one shall receive ANNOUNCE messages from the PTP Grandmaster. For this run the syn1588® PTP Stack at least with log level 3. All incoming, received PTP messages are flagged by an text arrow to the right "--->". One can simply grep for these lines in the text output.

Note, one has to set the verbosity level to "debug" ("-v debug") in order to see this information in the syn1588® PTP Stack log output.

Further note, you can directly grep the syn1588® PTP Stack log output in order to simply things. The following example shows how to check just for incoming PTP messages.

./ptp -i eth0 -C S -d 50 -v debug | grep -e '--->'

```
] [p1.engin
2023-10-05 08:18:40.870632 [INFO
                                                        State Change Uncalibrated ->
Slave2023-10-05 08:18:41.4662state changep1.
                                                        ] <--- DlyReq seqId: 58
2023-10-05 08:18:41.466788 [DEBUG
                                                        ---> DlyResp seqId: 58
                                    ] [pl.engine
                                                    1
2023-10-05 08:18:41.466812 [DEBUG
                                   ] [p1.engine
                                                       T3 1696486758.466123653s T4
                                                     1
1696486758.466126906s DlyCor 8387 ns
2023-10-05 08:18:41.466823 [DEBUG ] [p1.clock
                                                    ] S2M-Delay -5134 [ns]
                                   ] [p1.clock
2023-10-05 08:18:41.466834 [DEBUG
                                                       Spike Path: calibrating...
2023-10-05 08:18:41.466846 [DEBUG
                                    ] [p1.clock
                                                       Filtered S2M-Delay -5134 [ns]
2023-10-05 08:18:41.48296$YNOmessagengin
                                                       ---> Sync seqId: 61035
2023-10-05 08:18:41.483021 [DEBUG ] [pl.engine
                                                       ---> FollowUp seqId: 61035
2023-10-05 08:18:41.483037 [DEBUG
                                   ] [p1.clock
                                                   ] Update M2S-Delay 20678 [ns]
2023-10-05 08:18:41.483048 [DEBUG
                                                       Spike M2S: calibrating...
                                    ] [p1.clock
                                                    1
2023-10-05 08:18:41.483060 [DEBUG
                                    ] [p1.clock
                                                    1
                                                       Filtered M2S-Delay 20678 [ns]
                                                       with mean pathDly 7772.00 ns
2023-10-05 08:18:41.483074 [DEBUG
                                   ] [p1.engine
2023-10-05 08:18:41.483095 [DEBUG ] [p1.engine
                                                    ] T1 1696486758.481832379s T2
1696486758.481861416s SyncCor 8359 ns Offset: 12906.00 ns
2023-10-05 08:18:41 493049 NEELS messagengin
                                                   ▶ <--- DlyReq seqId: 59
                                      [p1.engine
                                                       ---> Announce seqId: 14267
2023-10-05 08:18:41.493612 [DEBUG
                                                    ] Announce from
                                   ] [p1.engine
ec:46:70:ff:fe:0a:a1:91
2023-10-05 08:18:41.493656 [DEBUG
                                    ] [p1.engine
                                                    ]
                                                       ---> DlyResp seqId: 59
2023-10-05 08:18:41.493677 [DEBUG
                                    ] [pl.engine
                                                    ] T3 1696486758.492906508s T4
1696486758.492910096s DlyCor 8405 ns
2023-10-05 08:18:41.493689 [DEBUG ] [p1.clock
                                                    ] S2M-Delay -4817 [ns]
2023-10-05 08:18:41.493700 [DEBUG
                                   ] [p1.clock ] Spike Path: calibrating...
2023-10-05 08:18:41.493712 [DEBUG ] [p1.clock ] Filtered S2M-Delay -48: 2023-10-05 08:18:41.514193 [DEBUG ] [p1.engine ] ---> Sync seqId: 61036
                                    ] [p1.clock
                                                       Filtered S2M-Delay -4817 [ns]
2023-10-05 08:18:41.514252 [DEBUG ] [p1.engine ] ---> FollowUp seqId: 61036
2023-10-05 08:18:41.514267 [DEBUG ] [p1.clock
                                                   ] Update M2S-Delay 20249 [ns]
2023-10-05 08:18:41.514279 [DEBUG ] [p1.clock 2023-10-05 08:18:41.514290 [DEBUG ] [p1.clock
                                                   ]
                                                       Spike M2S: calibrating...
                                                    ]
                                                       Filtered M2S-Delay 20249 [ns]
2023-10-05 08:18:41.514305 [DEBUG ] [p1.engine ] with mean pathDly 7716.00 ns
2023-10-05 08:18:41.514325 [DEBUG ] [p1.engine
                                                   ] T1 1696486758.513106674s T2
1696486758.513135390s SyncCor 8467 ns Offset: 12533.00 ns
2023-10-05 08:18:41.531581 [DEBUG ] [pl.engine ] <--- DlyReq seqId: 60
2023-10-05 08:18:41.532097 [DEBUG
                                                       ---> DlyResp seqId: 60
                                    ] [pl.engine
                                                    1
2023-10-05 08:18:41.532121 [DEBUG
                                   ] [p1.engine
                                                  ] T3 1696486758.531439551s T4
1696486758.531443026s DlyCor 8403 ns
2023-10-05 08:18:41.532133 [DEBUG ] [p1.clock
                                                       S2M-Delay -4928 [ns]
                                                    1
                                    ] [p1.clock
2023-10-05 08:18:41.532143 [DEBUG
                                                    ]
                                                        Spike Path: calibrating...
2023-10-05 08:18:41.532155 [DEBUG ] [p1.clock 2023-10-05 08:18:41.8601 State Information gin
                                                       Filtered S2M-Delay -4928 [ns]
                                                       1696486758.859918922s State
```

figure 8 syn1588® PTP Stack: check for incoming ANNOUNCE messages

In this example a SYNC messages is received first. The local PTP node now moves from the state "Initializing" to the state "Listening". Without receiving SYNC or ANNOUNCE messages the node will remain in the state "Initializing". If one does not see ANNOUNCE messages here your PTP, IP or node setup is corrupted. Either an improper IP configuration may inhibit the syn1588® PTP Stack to receive the Grandmaster's PTP messages or a local firewall blocks the PTP traffic. PTP utilize the UDP ports 319 and 320. Correct your system settings until you see the expected PTP messages here. Additionally, the Grandmaster may use another PTP clock domain than it is configured for the PTP slave. One can use Wireshark and check the PTP clock domain used by the Grandmaster.

Note, that the announce interval of the PTP slaves must match the announce interval used by the Grandmaster. The PTP slaves derive an announce timeout period based on the configured announce interval. If the Grandmaster sends ANNOUNCE messages not within the announce timeout period the PTP slave will also never change its state to "Slave".

After receiving twice the correct ANNOUNCE message the PTP slave moves from the state "Listening" to the state "Uncalibrated"; the PTP master had been accepted now.

One can use Wireshark on the same network interface to check whether the expected ANNOUNCE messages are physically available on the network interface.

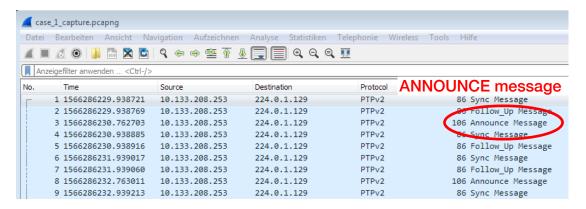


figure 9 Wireshark: check for incoming ANNOUNCE messages

If one would like to check the PTP clock domain used by the Grandmaster, select e.g. an Announce message sent by the Grandmaster and check the PTP message details as shown in the next figure.

```
▶ Frame 3: 106 bytes on wire (848 bits), 106 bytes captured (848 bits) on interface 0
▶ Ethernet II, Src: Microchi_85:d0:fd (00:1e:c0:85:d0:fd), Dst: IPv4mcast_01:81 (01:00:5e:00:01:81)
▶ Internet Protocol Version 4, Src: 10.133.208.253, Dst: 224.0.1.129
▷ User Datagram Protocol, Src Port: ptp-general (320), Dst Port: ptp-general (320)

■ Precision Time Protocol (IEEE1588)

    0000 .... = transportSpecific: 0x0

     .... 1011 = messageId: Announce Message (0xb)
    .... 0010 = versionPTP: 2
     messageLength: 64
     subdomainNumber: ७
                           PTP clock domain
    flags: 0x0008
     consection: 0.000000 nanoseconds
     ClockIdentity: 0x001ec0fffe85d0fd
    SourcePortID: 1
     sequenceId: 96
     control: Other Message (5)
     logMessagePeriod: 1
    originTimestamp (seconds): 0
    originTimestamp (nanoseconds): 0
     originCurrentUTCOffset: 37
    priority1: 128
     grandmasterClockClass: 6
     grandmasterClockAccuracy: The time is accurate to within 100 us (0x27)
     grandmasterClockVariance: 65535
     priority2: 128
     grandmasterClockIdentity: 0x001ec0fffe85d0fd
     localStepsRemoved: 0
     TimeSource: INTERNAL OSCILLATOR (0xa0)
                                                        ··^····E
     01 00 5e 00 01 81 00 1e c0 85 d0 fd 08 00 45 00
0010 00 5c 4f a9 40 00 01 11 6c e4 0a 85 d0 fd e0 00 0020 01 81 01 40 01 40 00 48 75 8f 0b 02 00 40 00 00
                                                        ....@.@.H u....@...
0040 c0 ff fe 85 d0 fd 00 01 00 60 05 01 00 00 00 00
0050 00 00 00 00 00 00 00 25 00 80 06 27 ff ff 80 00
                                                        .....% ....'....
0060 le c0 ff fe 85 d0 fd 00 00 a0
                                                        . . . . . . . . . . . . .
```

figure 10 Wireshark: check for the PTP clock domain

The following syn1588® PTP Stack log output shows an error condition. This happens if a local firewall blocks the PTP traffic on the PTP slave. No SYNC and ANNOUNCE messages can be received by the syn1588® PTP Stack.

Note, one has to set the verbosity level to "debug" ("-v debug") in order to see this information in the syn1588® PTP Stack log output.

```
oregano@KAEFER:/opt/oregano/bin$ sudo ./ptp -i enp2s0 -C S -v debug -r 0
2022-01-05 15:48:48.845172 [INFO ] [
                                                 ] syn1588(R) PTP Stack -
IEEE1588-2008 Engine
2022-01-05 15:48:48.845206 [INFO
                                   ] [
                                                 | Build date: 2022-01-
05T12:43:16 - v1.14-9-g7cbf9e73
2022-01-05 15:48:48.845212 [INFO
                                   ] [
                                                  ] Copyright (c) Oregano Systems
- Design & Consulting GesmbH 2005-2022
2022-01-05 15:48:48.845217 [INFO
                                                 ] Confidential unpublished data
                                  ] [
- All rights reserved
2022-01-05 15:48:48.845224 [INFO
                                                 ] syn1588(R) PTP Stack started:
2022-01-05 14:48:48.845222 (UTC)
2022-01-05 15:48:48.845317 [INFO
                                                 ] Port 1: adding config "i" =
                                  ] [p1
"enp2s0"
                                                  no incoming messages
] Port 1: adding config "C" =
2022-01-05 15:48:48.845327 [INFO
                                  ] [p1
                                                  and
2022-01-05 15:48:48.845333 [INFO
                                                  Port 1: adding config "v" =
                                   ] [p1
                                                  no outgoing messages
"info"
2022-01-05 15:48:48.845338 [INFO
                                                 ] Port 1: adding config "r" =
                                   ] [p1
"0"
2022-01-05 15:48:48.845344 [INFO
                                   ] [p1
                                                 1 PTP version 2.0
2022-01-05 15:48:48.845348 [INFO
                                                 ] Command line: ./ptp -i enp2s0
                                 ] [
-C S -v info -r 0
2022-01-05 15:48:48.845358 [WARNING ] [
                                                 ] Failed to set high priority
for the PTP thread!
2022-01-05 15:48:48.845365 [INFO
                                                 ] Found Configuration for 1
                                  ] [p1
2022-01-05 15:48:48.845563 [INFO
                                  ] [syn1588
                                                 ] Syn1588Ifc requires at least:
2022-01-05 15:48:48.845571 [INFO
                                  ] [syn1588
                                                  ] - linux driver version 1.4-15-
q05b7283
2022-01-05 15:48:48.845576 [INFO
                                  ] [syn1588
                                                 ] - windows driver version
10/05/2017, 10.9.16.182
2022-01-05 15:48:48.845590 [INFO
                                  ] [syn1588
                                                  ] Device /dev/syncD0 found
2022-01-05 15:48:48.845608 [INFO
                                   ] [syn1588
                                                  ] syn1588(R) Hardware Clock M
2.3.5 f=125000000 Hz
2022-01-05 15:48:48.845617 [INFO
                                  ] [syn1588
                                               ] Found stop clock support
] Using MAC TS Version 3160
                                  ] [syn1588
2022-01-05 15:48:48.845630 [INFO
                                                 ] Using programmable 1-step TS
2022-01-05 15:48:48.845635 [INFO
                                  ] [syn1588
2022-01-05 15:48:48.845653 [INFO
                                                  ] syn1588(R) PCIe NIC Revision
                                  ] [syn1588
2. Build 876
                                2022-01-05 15:48:48.845669 [INFO
2022-01-05 15:48:48.845699 [INFO
                                                 ] Spike M2S: Init with ival 0,
buffer size 16
2022-01-05 15:48:48.845762 [INFO
                                   ] [p1.clock
                                                 ] Spike Path: Init with ival 0,
buffer size 16
2022-01-05 15:48:48.845778 [INFO
                                  ] [p1.io
                                                 ] Init shared mem
                                  ] [syn1588
                                                 ] syn1588HwClk: clearing leap
2022-01-05 15:48:48.848090 [INFO
second jump
2022-01-05 15:48:48.848103 [INFO
                                 ] [p1.engine ] Settings: ClockId
00:1e:c0:ff:fe:85:de:2b
2022-01-05 15:48:48.848112 [INFO
                                 ] [pl.engine
                                                 ] Settings: Prio1 128 ClkClass
255 clkAccuracy 39 clkVariance 65535
2022-01-05 15:48:48.848119 [INFO ] [p1.engine ] Settings: Prio2 128 Domain 0
2022-01-05 15:48:48.848235 [INFO ] [p1.network.mcport] SIOCSHWTSTAMP: tx type 1
requested, got 1; rx filter 0 requested, got 12
```

```
2022-01-05 15:48:48.848245 [INFO
                                    [p1.network.mcport] Activated SO TIMESTAMPING
hardware
2022-01-05 15:48:48.848340 [INFO ] [p1.network.mcport] SIOCSHWTSTAMP: tx type 1
requested, got 1; rx_filter 0 requested, got 12
2022-01-05 15:48:48.848349 [INFO
                                    [p1.network.mcport] Activated SO TIMESTAMPING
hardware
2022-01-05 15:48:48.848599 [INFO
                                    ] [p1.clock
                                                     ] Clk: Using Oregano Systems;
syn1588(R) PCIe NIC Revision 2; 00:1E:C0:85:DE:2B
2022-01-05 15:48:48.848608 [INFO
                                                         with ClockId
                                   ] [p1.clock
                                                     1
00:1e:c0:ff:fe:85:de:2b
2022-01-05 15:48:48.848742 [INFO ] [p1.clock ] Clk: Resetting servos 2022-01-05 15:48:48.848748 [INFO ] [p1.clock ] Clk: Resetting filters
                                                    ] Spike M2S: Init with ival 0,
2022-01-05 15:48:48.848755 [INFO
                                    ] [p1.clock
buffer size 16
2022-01-05 15:48:48.848764 [INFO
                                                     ] Spike Path: Init with ival 0,
                                    ] [p1.clock
buffer size 16
2022-01-05 15:48:48.848774 [INFO
                                    ] [p1.io
                                                    ] Init shared mem
                                    ] [syn1588
2022-01-05 15:48:48.848787 [INFO
                                                     ] syn1588HwClk: clearing leap
second jump
2022-01-05 15:48:48.848812 [INFO
                                            state Listening 4165 844694021s State
                                                     ] 1641394166.844705515s State
2022-01-05 15:48:49.848829 [INFO
                                    ] [p1.engine
Listening
2022-01-05 15:48:50.848892 [INFO
                                                     ] 1641394167.844765665s State
                                    ] [p1.engine
Listening
2022-01-05 15:48:51.849043 [INFO
                                    [pl.engine] 1641394168.844914696s State
Listenina
```

figure 11 syn1588® PTP Stack: active firewall blocking PTP traffic

Note, there are no incoming messages flagged by "--->" seen in the log file. The PTP slave remains in the state "Listening". Please further note, that the syn1588® PTP Stack does not send any packet in this state since it instructed to act as PTP slave; there are no outgoing messages as well "<---". In Wireshark one can still see these PTP messages on the network interface. Wireshark does not care about firewalls.

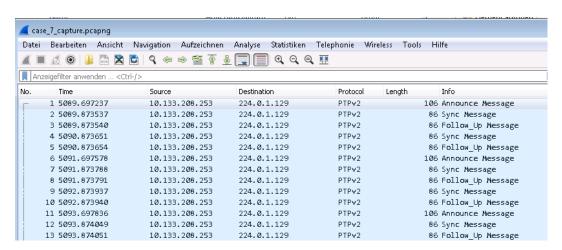


figure 12 Wireshark: PTP messages with active firewall blocking PTP traffic

The following syn1588® PTP Stack log output shows what happens if the PTP slave receives messages from

If the Grandmaster sends PTP messages with a wrong PTP clock domain these messages have to be ignored by the syn1588® PTP Stack. Thus the PTP slave remains in the state "Listening". If one increases the syn1588® PTP Stack' log level using the maximum verbosity level of 4 one will see a hint for such a wrong PTP clock domain value.

```
2022-01-07 11:30:10.355507 [DEBUG ] [pl.network
                                                  ] Event message
2022-01-07 11:30:10.355559 [DEBUG ] [pl.engine
                                                  [Sync] Message with wrong
                                   wrong PTP
domain received (0)
2022-01-07 11:30:10.355585 [DEE
                                                  Invalid message received
                                 clock domain
2022-01-07 11:30:10.855502 [DEE
                                                    Event message of size 44
2022-01-07 11:30:10.855552 [DEBUG ] [p1.engine
                                                  [Sync] Message with wrong
domain received (0)
2022-01-07 11:30:10.855577 [DEBUG
                                  ] [pl.engine
                                                 ] Invalid message received
2022-01-07 11:30:11.054312 [DEBUG
                                 ] [pl.engine
                                                    Timeout: state Listening
                                                 1
```

figure 13 syn1588® PTP Stack: wrong clock domain with log level debug

Check for SYNC messages

One can use the identical procedure as described in the previous chapter to check for SYNC messages received. The following excerpt of the syn1588® PTP Stack log file shows the received SYNC messages.

Note, one has to set the verbosity level to "debug" ("-v debug") in order to see this information in the syn1588® PTP Stack log output.

```
2022-01-05 15:48:58.760074 SYNC message
                                                    ---> Sync seqId: 707
2022-01-05 15:48:58.760125 [INFO
                                                 Update M2S-Delay 264 ns
                                ] [p1.clock
2022-01-05 15:48:58.760153 [INFO
                                  ] [p1.engine
                                                ]
                                                    with mean pathDly 183.00 ns
2022-01-05 15:48:58.760185 [INFO
                                  ] [p1.engine
                                                  ] T1 1641394175.755787234s T2
1641394175.755787498s SyncCor 0 ns Offset: 81.00 ns
2022-01-05 15:48:58.854254 [INFO ] [p1.engine ] 1641394175.850100632s State
Slave
                                  [ pl.engine ] <--- DlyReq seqId: 14
[ pl.engine ] ---> DlyResp seqId: 14
2022-01-05 15:48:58.953002 [INFO
2022-01-05 15:48:58.953195 [INFO
2022-01-05 15:48:58.953259 [INFO
                                  [p1.engine] T3 1641394175.948930625s T4
1641394175.948930729s DlyCor 0 ns
2022-01-05 15:48:58.953294 [INFO
                                  l [p1.clock
                                                 N S2M-Delay 104 ns
2022-01-05 15:48:59.260077 SYNC message
                                                    ---> Sync seqId: 708
                                 ] [pl.clock
                                                 ] Update M2S-Delay 263 ns
2022-01-05 15:48:59.260130 [INFO
2022-01-05 15:48:59.260158 [INFO
                                                  ] with mean pathDly 183.50 ns
                                  ] [p1.engine
                                                  ] T1 1641394176.255785872s T2
2022-01-05 15:48:59.260189 [INFO
                                 ] [p1.engine
1641394176.255786135s
                      SyncCor 0 ns Offset:
                                               79.50 ns
```

figure 14 syn1588® PTP Stack: check for incoming SYNC messages

PTP defines two basic communication mechanisms.

- 2-step mode
- 1-step mode

In the example shown above 1-step mode is used. The sender inserts the timestamp on-the-fly directly into the SYNC packet. For 2-step operation every SYNC is accompanied by a FOLLOW-UP message that sends the timestamp

Check for DELAY REQUEST & DELAY RESPONSE messages

As soon as the PTP slave proceeds in the "Uncalibrated" state it starts sending DELAY REQUEST messages that shall be answered by DELAY RESPONSE message by the Grandmaster. Note, that the DELAY REQUEST messages are sent (outgoing message) by the PTP slave and thus are preceded by a arrow to the left "<---". One can again grep for this pattern.

Note, one has to set the verbosity level to "debug" ("-v debug") in order to see this information in the syn1588® PTP Stack log output.

```
2022-01-05 15:48:57.760077 [INFO ] [p1.engine ] ---> Sync seqId: 705
2022-01-05 15:48:57.760129 [INFO ] [p1.clock ] Update M2S-Delay 274 ns
                                 ] [pl.clock
                                                 ] Spike M2S: Init with ival -1,
2022-01-05 15:48:57.760156 [INFO
buffer size 32
2022-01-05 15:48:57.760195 [INFO ] [pl.engine ] with mean pathDly 189.50 ns
2022-01-05 15:48:57.760219 [INFO ] [p1.engine ] T1 1641394174.755789711s T2
1641394174.755789985s SyncCor 0 ns Offset: 84.50 ns
2022-01-05 15:48:57.760277 [INFO ] [p1.engine ] ---> Announce seqId: 176
2022-01-05 15:48:57.853340 [TNFO
                                                   ] 1641394174.849190507s State
                                   l [pl.engine
        DELAY REQUEST message
Slave
2022-01-05 15:48:58.086576 [INFO ] [p1.engine ] <--- DlyReq seqId: 12 2022-01-05 15:48:58.086775 [INFO ] [p1.engine ] ---> DlyResp seqId: 12
                                                     ---> DlyResp seqId: 12
2022-01-DELAY RESPONSE message
                                                     T3 1641394175.082511583s T4
16413941/5.0825116/9s DlyCor U ns
2022-01-05 15:48:58.086875 [INFO
                                   ] [p1.clock
                                                  ] S2M-Delay 96 ns
```

figure 15 syn1588® PTP Stack: check for outgoing DELAY REQUEST and incoming DELAY RESONSE messages

If one does not receive DELAY RESPONSE messages the DELAY REQUEST messages might have been filtered on their way to the Grandmaster.

Transition to Slave State

After successfully receiving several DELAY RESPONSE messages the PTP slave proceeds from the state "Uncalibrated" to the state "Slave".

Note, one has to set the verbosity level to "debug" ("-v debug") in order to see this information in the syn1588® PTP Stack log output.

```
2022-01-05 15:48:57.260080 [INFO
                                    ] [p1.engine
                                                   N ---> Sync seqId: 704
2022-01-05 15:48:5 Vaster-ton Slave delay lock
                                                       Update M2S-Delay 277 ns
                                                   with mean pathDly 189.50 ns
                                   ] [p1.engine
2022-01-05 15:48:57.260164 [INFO
                                                  ] T1 1641394174.255790991s T2
2022-01-05 15:48:57.260193 [INFO
                                    ] [p1.engine
1641394174.255791268s SyncCor 0 ns Offset: 87.50 ns
2022-01-05 15:48:57.486784 [INFO ] [p1.clock
                                                   ] DriftCalc: drift is 5 ns/s
                                                    ] Adjust rate by -4184.9 ns/s
2022-01-05 15:48:57.486845 [INFO
                                   ] [syn1588
(speeding up)
2022-01-05 15:48:57.486893 [INFO
                                    ] [syn1588
                                                   ] Setting step to 0x00000800,
0x0231b033, 8.000033479 ns
2022-01-05 15:48:57.486944 [INFO
                                    [p1.clock ] Clk: Resetting filters
2022-01-05 15:48:57.486969 [INFO
                                    ] [p1.clock
                                                    ] Spike M2S: Init with ival 0,
buffer size 16
2022-01-05 15:48:57.487039 [INFO
                                    ] [p1.clock
                                                    ] Spike Path: Init with ival 0,
buffer size 16
2022-01-05 15:48:57.487118 [INFO
                                    ] [p1.clock
                                                    ] Drift calc completed
2022-01-05 15:48:57.487164 state change ;ine
                                                        Diykeq seqid: 1
2022-01-05 15:48:57.487298 LINEU
                                    ] [pr.engine
                                                    ] State Change Uncalibrated ->
Slave
2022-01-05 15:48:57.487419 [INFO
                                    ] [p1.engine
                                                   ] ---> DlyResp seqId: 10
2022-01-05 15:48:57.487446 [INFO
                                                    ] T3 1641394174.483103322s T4
                                    ] [p1.engine
1641394174.483103421s DlvCor 0 ns
2022-01-05 15:48:Slave-to-Master delay
                                                        S2M-Delay 99 ns
2022-01-05 15:48:57.487497 [INFO
                                    ] [p1.clock
                                                   ] Spike Path: Init with ival -1,
buffer size 32
                                    [ [p1.engine ] <--- DlyReq seqId: 11
] [p1.engine ] ---> DlyResp seqId: 11
2022-01-05 15:48:57.741356 [INFO
2022-01-05 15:48:57.741552 [INFO
                                    ] [p1.engine ] T3 1641394174.737306786s T4
2022-01-05 15:48:57.741593 [INFO
1641394174.737306891s DlyCor 0 ns
2022-01-05 15:48:57.741627 [INFO ] [p1.clock
                                    ] [pl.crock] | ---> Sync seque. ...
] [pl.engine] | ---> Sync seque. ...
] [pl.clock] | Update M2S-Delay 274 ns
                                                    ] S2M-Delay 105 ns
2022-01-05 15:48:57.760077 [INFO
                                  ] [p1.clock
2022-01-05 15:48:57.760129 [INFO
2022-01-05 15:48:57.760156 [INFO
                                  ] [p1.clock
                                                    ] Spike M2S: Init with ival -1,
buffer size 32
2022-01-05 15:48:57.760195 [INFO ] [p1.engine 2022-01-05 15:48:57.760219 [INFO ] [p1.engine
                                                   j with mean pathDly 189.50 ns
j T1 1641394174.755789711s T2
1641394174.755789985s SyncCor 0 ns Offset: 84.50 ns
2022-01-05 15:48:57.760277 [INFO ] [pl.engin-
                                                        ---> ^nnounce
                                                                      segid: 176
                                  [p1.engin state Slave 174.849190507s State
2022-01-05 15:48:57.853340 [INFO
Slave
                                                    ] <--- DlyReq seqId: 12
2022-01-05 15:48:58.086576 [INFO
                                    ] [p1.engine
2022-01-05 15:48:58.086775 [INFO
                                    ] [p1.engine ] ---> DlyResp seqId: 12
2022-01-05 15:48:58.086839 [INFO
                                    ] [p1.engine
                                                  ] T3 1641394175.082511583s T4
1641394175.082511679s DlyCor 0 ns
                                                   ] S2M-Delay 96 ns
2022-01-05 15:48:58.086875 [INFO
                                    ] [p1.clock
```

figure 16 syn1588® PTP Stack: transition to state "Slave"

Now the PTP slave is fully synchronized with the master. The syn1588[®] PTP Stack log output also reports the measured delays Master-to-Slave (M2S) and slave-to-Master (S2M) as well as the timestamps T1 – T4.

Offset to Master

One shall observe that over the time the offset of the slave to the master is reduced to a minimum. The speed of this adaptation depends on the selected clock servo algorithm and parameters. The syn1588® PTP Stack log output displays two types of offset values:

- unfiltered offset
- filtered offset

Only the latter value is a useful measure for the current state of the synchronization.

```
] ---> Sync seqId: 716
2022-01-05 15:49:03.260086 [INFO
                                   ] [pl.engine
2022-01-05 15:49:03.260138 [INFO
                                                     Update M2S-Delay 173 ns
                                  ] [p1.clock
                                                  1
2022-01-05 15:49:03.260167 [INFO
                                                     with mean pathDly 189.00 ns
                                   ] [pl.engine
                                                  1
2022-01-05 15:49:03.260197 [INFO
                                     [pr.engine
                                                  ] Ti 1641394180.255775631s T2
1641394180.255775804s SyncCor 0 ns Offset: -16.00 ns
                                                            unfiltered offset
                                  ] [pl.engine
                                                          DlyReq seqId: 22
2022-01-05 15:49:03.557410 [INFO
                                   ] [p1.engine
                                                  ] ---> DlyResp seqId: 22
2022-01-05 15:49:03.557584 [INFO
2022-01-05 15:49:03.557623 [INFO
                                                ] T3 1641394180.553316087s T4
                                   ] [pl.engine
1641394180.553316299s DlyCor 0 ns
2022-01-05 15:49:03.557667 [INFO
                                 ] [p1.clock ] S2M-Delay 212 ns
                                                ] Spike Path: Ignoring 212
] ---> Sync seqId: 717
2022-01-05 15:49:03.557694 [INFO
                                  ] [p1.clock
2022-01-05 15:49:03.760095 [INFO
                                  ] [p1.engine
                                                 ] Update M2S-Delay 169 ns
2022-01-05 15:49:03.760146 [INFO
                                  ] [p1.clock
2022-01-05 15:49:03.760174 [INFO
                                 ] [pl.engine ] with mean pathDly 184.00 ns
2022-01-05 15:49:03.760205 [INFO
                                  ] [p1.engine
                                                  ] T1 1641394180.755775656s T2
1641394180.755775825s SyncCor 0 ns Offset: -15.00 ns
2022-01-05 15:49:03.760257 [INFO
                                  ] [pl.engine ] ---> Announce seqId: 179
2022-01-05 15:49:03.857178 [INFO
                                   ] [p1.engine
                                                 ] 1641394180.853000946s State
Slave
                                   filtered offset
2022-01-05 15:49:03.857271 [INFO
                                                   Adjusting clock at -15.00 ns
                                   ] [pl.clock
offset
2022-01-05 15:49:03.857425 [INFO
                                                 ] changed boundary to
                                                                               25
                                   ] [p1.clock
ns(17)
2022-01-05 15:49:03.857469 [INFO
                                   ] [p1.clock
                                                  ] Spike M2S: mean: 171, median:
172, variance: 66
2022-01-05 15:49:03.857578 [INFO
                                   ] [p1.clock
                                                  ] Spike Path: mean: 202, median:
202, variance: 114
2022-01-05 15:49:03.857603 [INFO
                                   ] [syn1588
                                                  ] Adjust rate by -4188.77 ns/s
(speeding up)
2022-01-05 15:49:03.857712 [INFO
                                   ] [syn1588
                                                  ] Setting step to 0x00000800,
0x023234f3, 8.000033510 ns
2022-01-05 15:49:04.191773 [INFO
                                   [p1.engine ] <--- DlyReq seqId: 23</pre>
2022-01-05 15:49:04.192077 [INFO
                                   [p1.engine ] ---> DlyResp seqId: 23
2022-01-05 15:49:04.192124 [INFO
                                                  ] T3 1641394181.187676695s T4
                                   ] [p1.engine
1641394181.187676904s DlyCor 0 ns
2022-01-05 15:49:04.192154 [INFO
                                   ] [p1.clock
                                                  ] S2M-Delay 209 ns
```

figure 17 syn1588® PTP Stack: offset to the master

Multicast Operation

When using multicast network mode for PTP the whole (!) network infrastructure has to be set up to properly connect also the multicast messages from the Grandmaster to all PTP nodes.

Presence of a Transparent Clock

In case transparent clocks (TCs) are on the path from the Grandmaster to the PTP slave another field will be displayed in the syn1588® PTP Stack log output:

the correction field

The correction field value summarizes all time the PTP packet resided onto such a transparent clock while packet traverses from the Grandmaster to the PTP slave and vice versa. The syn1588® PTP Stack uses this information in it's offset calculation. If no standard Ethernet switches are used in the network but just TCs, the resulting master-to-slave offset is almost the same as if the Grandmaster and PTP slave would have been connected by a direct network cable.

```
] [p1.engine
2022-01-05 15:49:02.260084 [INFO
                                                       ] ---> Sync seqId: 714
2022-01-05 15:49:02.260136 [INFO
                                      ] [p1.clock
                                                       ] Update M2S-Delay 171 ns
2022-01-05 15:49:02.260165 [INFO
                                      [p1.engine ] with mean pathDly 184.00 ns
2022-01-05 15:49:02.260194 [INFO ] in
1641394179.255778355s SyncCor 2801 ns
                                      ] in1.engine | T1 1641394179.255778184s T2
                                           Offset:
                                                      -13.00 ns
                                      | [pl.engine | ---> DlyReq seqId: 20 | [pl.engine | ---> DlyResp seqId: 20
2022-01-05 15:49:02.418640 [INF
2022-01-05 15:49:02.418837 [INFO
                                        [pl.engine ] T3 1641394179.414553258s T4
2022-01-05 15:49:02.418900 [INFO
1641394179.414553454 DlyCor 2811 ns
2022-01-05 15:49:02.410935 [INFO
                                         p1.clock
                                                       ] S2M-Delay 196 ns
                                      ] [p1.engine
2022-01-05 15:49:02.760085 [INFO
                                                          ---> Swnc seqId: 715
2022-01-05 15:49:02.760135 [INFO
                                      [p1.cl correction fields :s-Delay 166 ns
2022-01-05 15:49:02.760163 [INFO
                                      ] [p1.engine ] with mean pathDly 181.00 ns
2022-01-05 15:49:02.760198 [INFO pl.engine 1641394179.755777160 SyncCor 2819 ns Offset:
                                                       ] T1 1641394179.755776994s T2
                                                     -15.00 ns
                                       [p1.engine ] <--- DlyReq seqId: 21
2022-01-05 15:49:02.827916 [INFO
2022-01-05 15:49:02.828220 [INFO
                                      ] [p1.engine ] ---> DlyResp seqId: 21
2022-01-05 15:49:02.828269 [INFO ] 1641394179.8238267598 DlyCor 2795 ns
                                        [p1.engine
                                                      ] T3 1641394179.823826554s T4
2022-01-05 15:49:02.82829
                                         [p1.clock
                                                       ] S2M-Delay 205 ns
2022-01-05 15:49:02.856651 [INFO
                                      [p1.engine] 1641394179.852479375s State
Slave
```

figure 18 syn1588® PTP Stack: presence of a TC - correction fields



A Meinberg Company

Franzosengraben 8 A-1030 Vienna

Austria

http://oregano.at contact@oregano.at Copyright © 2023

Oregano Systems - Design & Consulting GmbH ALL RIGHTS RESERVED.

Oregano Systems does not assume any liability arising out of the application or use of any product described or shown herein nor does it convey any license under its patents, copyrights, or any rights of others.

Licenses or any other rights such as, but not limited to, patents, utility models, trademarks or tradenames, are neither granted nor conveyed by this document, nor does this document constitute any obligation of the disclosing party to grant or convey such rights to the receiving party.

Oregano Systems reserves the right to make changes, at any time without notice, in order to improve reliability, function or design. Oregano Systems will not assume responsibility for the use of any circuitry described herein.

All trademarks used in this document are the property of their respective owners.